

# InCos-D Transmitter for InPro-C... Temperature / humidity sensors

InCos - D
InCos - ... - CT
InCos - ... - VA

Subject to change!

Electrical transmitters in combination with InPro-C... sensors  
24 VAC/DC supply voltage, (0)4...20 mA/0...10 V analogue output

## Compact. Easy installation. Universal. Cost effective. Safe.

Type	Sensors (compulsory)	Function of sensors	Supply	Output	Add. output	Wiring diagram	Installation area
InCos- D	InPro-C... (see below)	°C, % rH, °C+% rH	24 VAC/DC	(0)4...20 mA / 0...10 V	–	SB 2.0	Safe area
InCos- D... - CT	Types as above with aluminium housing and seawater resistant coating (cable glands M16 brass nickel-plated, screws in stainless steel)						
InCos- D... - VA	Types as above with stainless steel housing for aggressive ambient (cable glands M20 brass nickel-plated, screws in stainless steel)						

Type	Function	Range	Probe/sensor length	Connection	Installation area sensor
InPro-CT-...	Temperature sensor	-40...+125 °C*	50 / 100 / 150 / 200 mm	Plug and socket to InCos-D...	Safe area
InPro-CF-...	Humidity sensor	0...100 % rH	50 / 100 / 150 / 200 mm	Plug and socket to InCos-D...	Safe area
InPro-CTF-...	Combination sensor	-40...+125 °C* / 0...100 % rH	50 / 100 / 150 / 200 mm	Plug and socket to InCos-D...	Safe area

↑ Sensor length \* at 50 mm length -40...+80 °C

### Product views and applications

...Cos-D... transmitter



InPro-C... sensors



...Cos-D...-CT



...Cos-D...-VA



Duct or room sensor



### Description

The InCos-D... transmitter generation with directly coupled InPro-C... sensors are a revolution for measuring temperature and/or humidity in HVAC systems, in chemical, pharmaceutical, industrial and offshore/on-shore plants.

IP66 protection, small dimensions, universal functions and technical data guarantee safe operation even under difficult environmental conditions. All sensors are programmable on site without any additional tools. The measuring ranges are scalable within the maximum ranges. The analogue output signal is either 0...10 VDC or (0)4...20 mA and can be selected on site. The integrated display (can be switched off as needed) is for parametrisation and an actual value indication at working mode.

### Highlights

- ▶ For industrial use
- ▶ Power supply 24 VAC/DC
- ▶ Scalable analogue output, selectable 0...10 V / (0)4...20 mA
- ▶ Integrated terminal box
- ▶ Display with backlight, can be switched off
- ▶ Password locking
- ▶ Down to -20 °C ambient temperature applicable
- ▶ Compact design and small dimension
- ▶ Robust aluminium housing (optional with seawater resistant coating) or in stainless steel
- ▶ IP66 protection

InPro-C – see additional data sheet

### Technical data

Supply voltage, frequency	24 VAC/DC $\pm 20\%$ (19,2...28,8 VAC/DC), 50/60 Hz
Current, power consumption	150 mA, ~ 4 W, internal fuse 500 mA, without bracket, not removable
Galvanic isolation	Supply for analogue in- and outputs min. 1,5 kV, supply for relay output min. 1,5 kV
Electrical connection	Terminals 0,14...2,5 mm <sup>2</sup> at integrated terminal box, stripping length 9 mm, torque 0,4...0,5 Nm, equipotential bonding 4 mm <sup>2</sup>
Cable glands	2 x M16 x 1,5 mm, for cable diameter ~ $\varnothing$ 5...9 mm
Cable glands ...-CT	2 x M16 x 1,5 mm, brass nickel-plated, for cable diameter ~ $\varnothing$ 6...10 mm
...-VA	2 x M20 x 1,5 mm, brass nickel-plated, for cable diameter ~ $\varnothing$ 6...13 mm
Protection class	Class I (grounded)
Display	2 x 16 digits, dot-matrix display, backlit, for configuration, user guidance, parameter and actual value indication
Control elements	3 buttons for configuration
Housing material	Aluminium die-cast housing, coated. Optional with seawater resistant coating (...-CT) or stainless steel housing, № 1.4581 / UNS-J92900 / similar AISI 316Nb (...-VA)
Dimensions (L x W x H)	Aluminium housing ~ 180 x 107 x 66 mm, stainless steel housing ~ 195 x 127 x 70 mm (each without connectors)
Weight	~ 950 g aluminium housing, stainless steel version ~ 2,5 kg
Ambient temperature	-20...+50 °C, storage temperature -35...+70 °C
Ambient humidity	0...95 % rH, non condensing
Sensor connection	<b>For InPro-C... sensor only!</b> Via plug and socket connection at front side (for room mounting) or at back side (for duct mounting). <b>Attention:</b> Only 1 InPro-C... sensor per transmitter can be connected!
InPro-C... sensors	More information of connectable InPro-C... sensors see separate data sheet
Measuring ranges adjustable	Measuring ranges are scalable within and limited by the maximum sensor measuring range
Response time of sensor	T90 / ~ 1 s
Start delay	5 s
Stability	Long term stability < 0,2 %/year, temperature influence < 0,02 %/K, supply voltage influence < 0,01 %
Output	Voltage U [V] or current I [mA] selectable via menu on site (with combi sensors not adjustable separately), protected against short circuit and external voltage up to 24 V, protected against polarity reversal
Voltage output U	0...10 V adjustable, invertible, burden > 1 k $\Omega$ , influence < 0,05 %/100 $\Omega$ + accuracy of ...Pro-C... sensor
Current output I	0...20 mA adjustable, invertible, burden < 500 $\Omega$ , influence < 0,1 %/100 $\Omega$ , open circuit voltage < 24 V + accuracy of ...Pro-C... sensor
Output in alarm mode	Increasing or decreasing output signal, selectable on site, down to 0 VDC/0 mA or up to 10 VDC/20 mA
Wiring diagram	SB 2.0
Scope of delivery	Transmitter, 3 self-tapping screws 4,2 x 13 mm resp. in stainless steel (with ...CT and ...VA versions)
Parameter at delivery	Output 4...20 mA, output in alarm mode decreasing to 0 V/0 mA

### Approbations

CE identification	CE
EMC directive	2014/30/EU
Enclosure protection	IP66 in acc. with EN 60529
EAC	TC N RU Д-DE.AB45.B.58607

### Special solutions and accessories

...-CT	Types in aluminium housing with seawater resistant coating, parts nickel-plated
...-VA	Types in stainless steel housing, parts nickel-plated
MKR	Mounting bracket for round ducts up to $\varnothing$ 600 mm
Kit-S8-CBR	2 cable glands M16 x 1,5 mm, Ex-e, brass nickel-plated, for cable $\varnothing$ 5...10 mm
VL3	Sensor extension cable, 3 m
WS-CBR	Stainless steel weather shield

**Electrical connection**

All transmitters require a 24 VAC/DC power supply. The electrical wiring must be realized via the integrated terminal box.


**Attention:** Before opening the terminal box cover, the supply voltage must be shut off! The supply has to be connected at terminals 1 (-/-) and 2 (+/+), the analogue output for temperature sensors at terminals 3 (mA/V) and 4 (GND), for humidity sensors at terminals 5 (mA/V) and 4 (GND).

Depending on the ...Pro-C... sensor's type you can measure either temperature (...Pro-CT...) or humidity (...Pro-CF...) at the time or combined with a ...Pro-CTF... Simultaneous measurings are not possible, use only one transmitter at the time.

Before starting parametrisation of ...Cos-D... transmitter a ...Pro-C... sensor must be connected, which can be mounted either to the front or the back side of the transmitter. The protective cap must be removed.

Unused connectors must be covered with the original protective cap to avoid mechanical damage and dirt!


Depending on the sensor's type you need to set parameters for one or two measuring ranges and their related data.

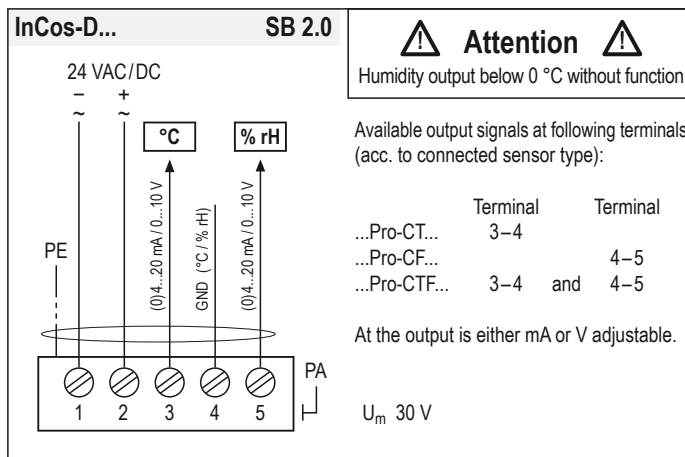

**Electric characteristics – For external InPro-C... sensor**

U 5 V  
I 0.5 mA

**Display, buttons and parameters**

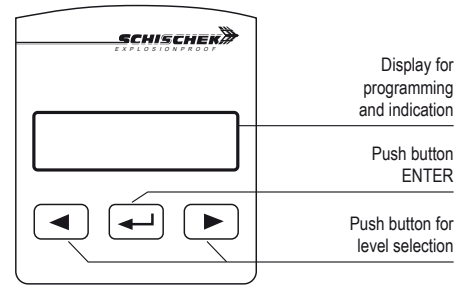

**Change operation – parametrisation mode**

To change from operation to parametrisation mode and vice versa, push ENTER button for minimum of 3 seconds. Back to operation mode with menu "save".

**Indication of data logging**

A flashing star in the display shows that data is received and the device is working.

**Password input**

The default/delivery setup is 0000. In this configuration the password input is not activated. To activate the password protection (menu 20) change the 4 digits into your chosen numbers (e.g. 1234) and press ENTER.

Please keep your password in mind for next parameter change! Due to a new parameter setup the password is requested.

**Important information for installation and operation**

**A. Installation, commissioning, maintenance**

All national and international standards, rules and regulations must be complied with. Apparatus must be installed in accordance with manufacturer instructions. If the equipment is used in a manner not specified by the manufacturer, the safety protection provided by the equipment may be impaired.

**Attention:** Apply all protective rules and regulation before opening the internal terminal box. Do not open cover when circuits are live!

Draw the wiring cables through the cable glands. For connection use the internal terminal box and connect equipotential bonding.

After connection install the cables in a fixed position and protect them against mechanical and thermal damage. Close all openings and ensure IP protection (min. IP66).

Avoid temperature transfer and ensure not to exceed max. ambient temperature! For outdoor installation a protective shield against sun, rain and snow should be applied. Sensors are maintenance free. An annual inspection is recommended.

Clean with damp cloth only.

Sensors must not be opened and repaired by the end user.

**B. Long cabling**

We recommend using shielded signal wires and to connect one end of the shield to the ...Cos-... terminal box.

**C. Separate ground wires**

For supply and signal wires use separate grounds.

**D. InPro-C... sensors**

The InPro-C... sensor is supplied by the transmitter's circuit. Unused connectors must be covered with a protective cap.

**Parametrisation and commissioning**

To change from operation to parametrisation mode push the "ENTER" button (↵) for minimum 3 seconds.  
If password protected: type password and push (↵).  
Skip menu with (▶), back to operation mode with menu "Save and exit".

Operation → Parametrisation  
push (↵) for min. 3 s




**Example:**  
Menu language English  
Ranges 0...50 °C, 0...100 % rF  
Output ranges 0...10 V, 0...10 V  
Add. output 0...20 mA

Menu	Function	ENTER	Indication	Select	ENTER	Next indication	Select	ENTER	Next menu
Menu 1	<b>DE, EN, FR</b> Select language: German, English, French	↵	DE, EN, FR English deutsch, english, francais	◀ ▶	↵				▶
Menu 2	no function – menu skip								
Menu 3	no function – menu skip								
Menu 4	<b>Unit sensor 1</b> Select physical unit	↵	unit sensor 1 °C °C, °F	◀ ▶	↵				▶
Menu 5	<b>Range 1</b> Adjust the measuring range	↵	range 1 0...50 °C ← adjust lower limit	◀ ▶	↵	range 1 0...50 °C ← adjust higher limit	◀ ▶	↵	▶
Menu 6	no function – menu skip								
Menu 7	<b>Output V mA</b> Select output signal	↵	output V mA mA V, mA	◀ ▶	↵				▶
Menu 8	<b>Output range 1</b> Adjust output range	↵	output range 1 0...10 mA ← adjust lower limit	◀ ▶	↵	output range 1 0...10 mA ← adjust higher limit	◀ ▶	↵	▶
Menu 9	<b>Sensor error 1</b> Select output signal at sensor error	↵	sensor error 1 10 V/20 mA 10 V/20 mA, 0 V/0 mA	◀ ▶	↵				▶
Menu 10	<b>Output 1</b> ↙↘ Select signal output behaviour	↵	output 1 ↙↘ increasing, decreasing increasing, decreasing	◀ ▶	↵				▶
Menu 11	<b>Unit sensor 2*</b> (humidity) Select physical unit	↵	unit sensor 2 % rF % rF, % rH	◀ ▶	↵				▶
Menu 12	<b>Range 2*</b> Adjust the measuring range	↵	range 2 0...100 % rF ← adjust lower limit	◀ ▶	↵	range 2 0...100 % rF ← adjust higher limit	◀ ▶	↵	▶
Menu 13	<b>Output range 2*</b> Adjust output range	↵	output range 2 0...10 V ← adjust lower limit	◀ ▶	↵	output range 2 0...10 V ← adjust higher limit	◀ ▶	↵	▶
Menu 14	<b>Sensor error 2*</b> Select output signal at sensor error	↵	sensor error 2 0 V/0 mA 0 V/0 mA, 10 V/20 mA	◀ ▶	↵				▶
Menu 15	<b>Output 2*</b> ↙↘ Select signal output behaviour	↵	output 2 ↙↘ increasing, decreasing increasing, decreasing	◀ ▶	↵				▶
Menu 16	no function – menu skip								
Menu 17	no function – menu skip								
Menu 18	no function – menu skip								
Menu 19	<b>Display function</b> Select display	↵	display function on illuminated on illuminated, off, on	◀ ▶	↵				▶
Menu 20	<b>Password</b> Select password protection	↵	new password yes no Ja	◀ ▶	↵	password 0000 push (↵) to change position	◀ ▶	↵	▶
Menu 21	<b>Save and exit</b> Select: save data, factory setting, discard or back to menu	↵	save and exit save data save data, factory setting, discard, back to menu	◀ ▶	↵	(operation mode after "save data")			▶
Menu 22	<b>Set offset 1</b> Add / subtract offset from measure value temperature	↵	set offset 1 -0,6 °C	◀ ▶	↵	Presetting by factory -0,6 °C for pre-compensation			▶
Menu 23	<b>Set offset 2*</b> Add / subtract offset from measure value humidity	↵	set offset 2 -0.02 % rH	◀ ▶	↵				▶

Alternative programming possible without ...Pro sensor plugged in.  
\*with combination sensor ...Pro-CTF only.

Dimensions (mm)

Aluminium housing

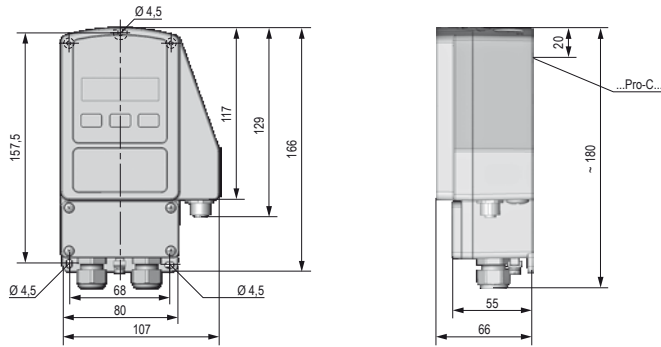

Stainless steel housing

